


**Závitové kruhové
čelisti
Circular dies
Schneideisen
Плашки**

W

Whitworthův závit
Whitworth thread
Whitworth-Gewinde
Резьба Витворта

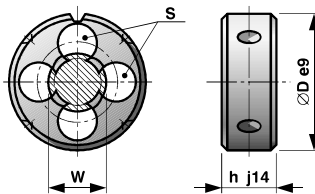

1,5P

	z/1"	P	D	h	S		code ^{*)}
W 1/16"	60	0,423	16	5	3	1,5	XXX 116
W 3/32"	48	0,529	16	5	3	2,3	XXX 332
W 1/8"	40	0,635	20	5	3	3,1	XXX 180
W 5/32"	32	0,794	20	5	3	3,9	XXX 532
W 3/16"	24	1,058	20	7	3	4,7	XXX 316
W 7/32"	24	1,058	20	7	4	5,5	XXX 732
W 1/4"	20	1,270	20	7	4	6,3	XXX 140
W 5/16"	18	1,411	25	9	4	7,9	XXX 516
W 3/8"	16	1,588	30	11	4	9,5	XXX 380
W 7/16"	14	1,814	30	11	5	11,1	XXX 716
W 1/2"	12	2,117	38	14	4	12,7	XXX 120
W 9/16"	12	2,117	38	14	5	14,2	XXX 916
W 5/8"	11	2,309	45	18	5	15,8	XXX 580
W 3/4"	10	2,540	45	18	5	19,0	XXX 340
W 7/8"	9	2,822	55	22	5	22,2	XXX 780
W 1"	8	3,175	55	22	6	25,4	XXX 100
W 1 1/8"	7	3,629	65	25	6	28,5	XXX 118
W 1 1/4"	7	3,629	65	25	7	31,7	XXX 114
W 1 3/8"	6	4,233	65	25	7	34,9	XXX 138
W 1 1/2"	6	4,233	75	30	7	38,1	XXX 112
W 1 5/8"	5	5,080	75	30	8	41,2	XXX 158
W 1 3/4"	5	5,080	90	36	7	44,4	XXX 134
W 1 7/8"	4,5	5,644	90	36	7	47,6	XXX 178
W 2"	4,5	5,644	90	36	8	50,8	XXX 200

^{*)} 211 XXX - NO / CS / WS

^{*)} 241 XXX - HSS

^{*)} 271 XXX - HSS s lamačem třísek / with spiral point / mit Schälanschnitt / с ломателем стружек

*Materiál: NO;
HSS, HSSE - dle požadavku
Provedení: závit lapovaný do
W 1"
Závit: pravý
Lícování: střední*

*Material: CS;
HSS, HSSE - on request
Execution: lapped thread to
W 1"
Thread: right-hand
Tolerance: medium class*

*Werkstoff: WS;
HSS, HSSE - nach dem
Anspruch
Ausführung: geläpftes Gewinde
bis W 1"
Gewinde: rechts
Toleranz: Mittelklasse*

*Material: NO;
HSS, HSSE - по заказу
Изготовлено: резьба
шлифованная до W 1"
Резьба: правая
Подгонка: средний класс*

